

SMARTElectrode 14.1.3.0

What's New





What


 Add new commands to group 'View' to display workpieces or electrodes with transparency.

Why

• Simplifies visual inspection of electrode's touching faces.

How


- Open menu to select style to activate.
- Only one style can be active at any time.
- Select option a 2nd time to disable style and return to default display.

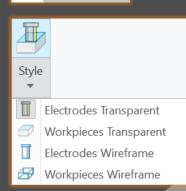




Description


- Erroneous creation of FREE_FACE in new electrodes (offset in negative direction).
- Erroneous adjustment of FREE_FACE in Base UI.
- https://redmine.buw-soft.de/issues/16099

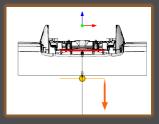


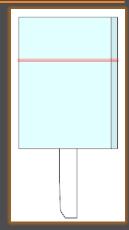

Cause

  Opposite orientation of start datums in electrode template.





Solution

- Check orientation of 1st solid csys vs. reference of FREE_FACE.
- Process inverted orientation during definition and redefinition.





Description

- Consider flipped normal vector for user-defined FREE_FACE.
- https://redmine.buw-soft.de/issues/16074

Cause

 Normal vector of user-defined FREE_FACE created on reference surface is not automatically parallel to normal vector of reference surface.

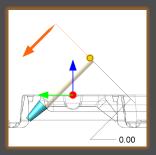

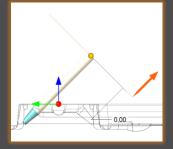

This may lead to a wrong orientation of FREE_FACE and base features.

Solution

Check orientation of datum plane FREE_FACE after creation and flip normal vector if necessary.



Description


- Table 'asm_edm' on separate electrode part drawing empty.
- https://redmine.buw-soft.de/issues/16088

Cause

- Assembly model not added as drawing model to electrode part drawing.
- Therefore, the table remains empty.

Solution

Add missing drawing model automatically before repeat region (table) is updated.

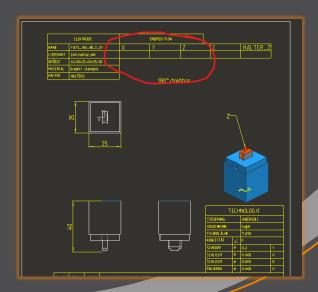



Description


- Automatic adjustment of Z position of FREE_FACE in Base UI fails.
- https://redmine.buw-soft.de/issues/15938


Cause

- Affected Versions:
 SMARTElectrode 15.1.2.0 in Creo 9.0.0.0 and 9.0.1.0
- More Information: https://www.ptc.com/en/support/article/CS369850.
- This issues leaves electrode base in initial position without any optimization.

Solution

Replaced broken API command with alternative solution.

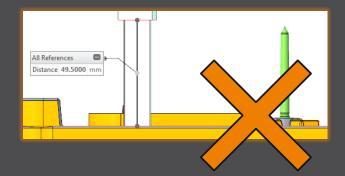

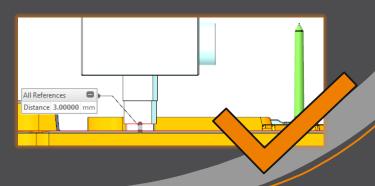



Description


- Export of electrodes associated to different zero point possible.
- https://redmine.buw-soft.de/issues/15864

Cause

 When exporting electrodes by selection or simplified representation, different zero points may be mixed.

Solution

- Selection of a zero point is now mandatory before export can be started.
- Electrodes not associated to selected zero point are skipped during export.
- A message is displayed if electrodes have been skipped.

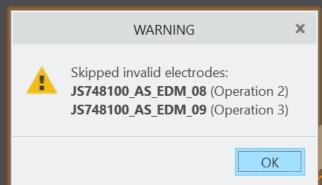



SMARTElectrode 14.1.2.0

What's New





What

Add automatic interference check as options to ribbon.

- https://redmine.buw-soft.de/issues/7330
- https://redmine.buw-soft.de/issues/7733

Offer instant feedback on changes in assembly or active component mode.

Why





How

- Enable mode to start evaluation automatically on regenerate, feature creation/suppress/resume/delete.
- Activation in assembly mode also activates check in component mode.
 - Activation in component mode only check active electrode and displays results for the same. Results from other components are hidden.
 - Use option AUTO_INTERFERENCE_CHECK to preset behavior in assembly mode.
 - Use option AUTO_INTERFERENCE_COMP_CHECK to preset behavior in active component mode.



What

 Ingersoll MultiProg/PowerSparkEditor: Introduce new parameter to write burndepth.

Why

https://redmine.buw-soft.de/issues/14573

 
Manufacturing depth is useful for edm program creation.

 
How

Add parameter with rule '&burndepth' to configuration.

BURN_DEPTH COMP DOUBLE Y N 8.3 N Y &burndepth

- It's recommended to add parameter as COMPONENT parameter to allow a different value for each electrode position.
- Value can be unlocked and overwritten.
- Default value will be calculated based on copied burn-faces (copy-geoms).







What

New parameter owner 'PROJECT'.

https://redmine.buw-soft.de/issues/15169

Why

How

 In some cases, its necessary to transfer a parameter value from assembly to electrode while maintaining the default rule for identification.

- Default rule '&inherit' not useable in these cases.
- Add parameter with owner 'PROJECT' in parameter configuration.
- Project parameters are automatically saved to assembly and electrode parts.
- Values can be unlocked and overwritten on assembly level or electrode part level.
- Value in assembly is the leading for locked part parameters.

PROJECTNR PROJECT STRING N N 12 N Y &projectid ORDERNR PROJECT STRING N N 12 N Y &order



What


Update simplified representations for enabled/disabled workpieces.
 https://redmine.buw-soft.de/issues/10294


Why

- Disabled workpieces should be hidden on drawing.
- Disabled workpieces shouldn't affect workpiece outline/dimensions

How

Open Burnsheet UI and use context menu to enable/disable workpieces.

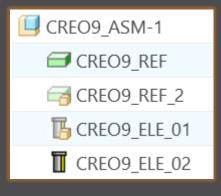

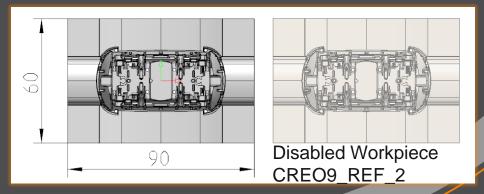



What


Unlink FREE_FACE from default plane in assembly.
 https://redmine.buw-soft.de/issues/15655


Why

- FREE_FACE is currently an offset datum plane from operation's default plane.
- This leads to problems if the electrode is reused in a different assembly.
- FREE_FACE is frozen an can't be changed if original assembly is not in session.

How

- FREE_FACE is now an offset from a local datum plane removing the external reference.
- Modification also works in assemblies reusing the electrode.

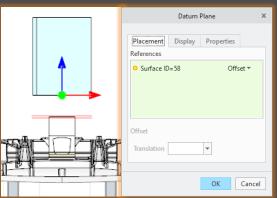

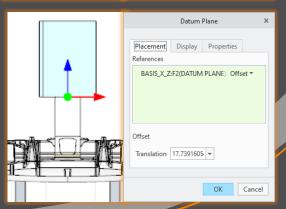



What

 Allow usage of multiple placeholders for drawing tables on templates. https://redmine.buw-soft.de/issues/7306

Why

- Requirement to display electrode information in different tables.
- For example, position and technology information should be displayed in separate tables:

Х	Y	Z	С
-15,800	3,375	5,000	0,000
15,800	3,375	5,000	0,000
15,800	-3,375	5,000	180,000
-11,800	-3,375	5,000	180,000

▼	▼ ▼	ORBIT	DEPTH
0.5	0.4	Kugel	1,000
0.5	0.4	Kugel	1,000
0.5	0.4	Kugel	1,000
0.5	0.4	Kugel	1,000

How

- Add placeholder tables to template with at least two rows and one column.
- Cell 1/1: table name (without extension .tbl).
- Cell 2/1: YES/NO (YES: use display from parameter configuration column 4).
- Only one table should be updated by software (=YES); the other tables should be used as saved (=NO).

ASM_EDM YES ADDITIONAL_TABLE NO



What

 Allow usage of multiple placeholders for drawing tables on templates. https://redmine.buw-soft.de/issues/7306

How

Additional information

Used simplified representation by drawing template:

- asm_bom: Master.
- asm_edm: simplified representation of electrode (groups all positions of electrode).
- asm_operation: all electrodes belonging to operation.
- asm_wp: simplified representation "SE_WORKPIECES".
- edm_default: simplified representation of electrode (groups all positions of electrode).




What

- Provide a custom template with free size in Base UI.
- https://redmine.buw-soft.de/issues/7209

Why

- Available template sizes are provided in a data file located in:
 <configuration>/electrode/<supplier>/<type>.dat
- Until now the last size in list is selected and changed if no matching size is found
- The name of the last size is still shown in Burnsheet UI and in drawing tables.
- The new release automatically adds a size "Custom" to the list.
- This size is used if no matching size is found, rounding base size (red) and reusing all other settings (blue) from last entry.
- Add your own custom size by adding
 A_BASE = -1 and B_BASE = -1 as last entry to data file. This skips automatic "Custom".

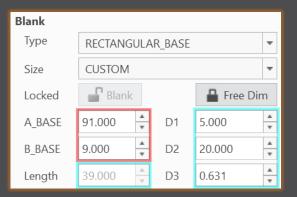

How

INSTANCE	A_BASE	B_BASE	LENGTH	D1	D2	D3
Sondergrösse	-1	-1	50	5	20	0



Description

- Interface ZK Alphamoduli: allow usage of custom order number.
- https://redmine.buw-soft.de/issues/14989

Cause

- By default, selected operation is used as order in output.
- Order number can be purely commercial information, therefore the need to overwrite the value arises.

Solution

- Introduction of new parameter rule '&order'.
- Can be used to set a custom order number.
- Selected operation will be used if custom parameter is empty.

ORDERNR PROJECT STRING N N 12 N Y &order



Description

- Interface ZK Alphamoduli: wrong recognition of blank shape for measure program type (MeasProgType).
- https://redmine.buw-soft.de/issues/14990

Cause

 In some cases, SE fails to recognize the shape of electrode frame leading to a wrong measure program type.

```
<!-- <MeasProgType>type of frame 0: Unknown; 1: Circle; 2: Rectangle --> <MeasProgType>1</MeasProgType>
```

Solution

- Improve process to recognize correct shape.
- Use custom parameter for output.
 - Parameter default &measureprogtype.
 - Add values to sel_list.txt.
- Use either automatic recognition or value from parameter.

parameter.cfg

PROGTYPE PART STRING N N 6 N Y &measureprogtype

sel_list.txt

#MEASUREPROGTYPE

1

.

0




Description


- Interface AC Form: possible wrong output of path from start to end position (PrepDepth).
- https://redmine.buw-soft.de/issues/14918

Cause

Problem appears if:

- electrode with more than one position.
- one or more electrode positions differ in start or end position.

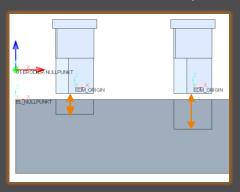

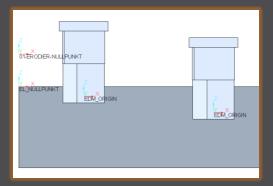

Solution

Each electrode position is exported as a new shape to avoid this problem.



SMARTElectrode 14.1.1.0

What's New



ENHANCEMENT



What


- Disable workpieces or electrodes in Burnsheet UI.
- https://redmine.buw-soft.de/issues/4595

Why

- Disable a design dummy. Especially when using electrode merge or mirror.
- Original position of an electrode should not be used in export.
- Use disabled auxiliary model to display a start-position.
- Disable outdated version of workpiece.

How

- Disabled components are ignored in export, collision check and touching surface analysis.
- Open Burnsheet UI and use right mouse button context menu to disable component.
- Disabled components are displayed with specific icons.

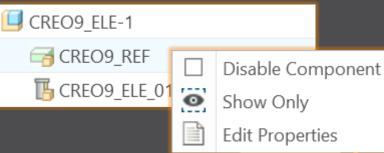

ENHANCEMENT



What

Allow usage of layer settings file during export of 3d data.

https://redmine.buw-soft.de/issues/14469

Why

More control over the result of the export.

How

 The file has to be named "layer_settings.txt" and has to be located in export or post-processor configuration. Examples can be found in configurations that create 3d exports. Customize content and rename "example_layer_settings.txt" to "layer_settings.txt" to activate.

Model Name	Export Status	Display Statu	us Layer Name
SE_EXPORT_TEMP	Exclude Conte	nt Blank	SE_EXPORT_TEMP



What

- Provide export profiles for some processors with installation.
- https://redmine.buw-soft.de/issues/14257

Why


How

Some interfaces include export of electrodes as STEP, IGES or PARASOLID.

 Export profile is necessary to include datum points used as CMM points.

Added profiles to:

- processor/ZK/pp/def_profile.dep_step
- processor/MAKINO/pp/def_profile.dep_para

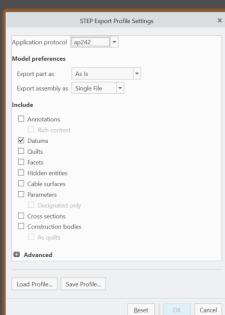



What

• Automatically add all axes to layer "SE_EXPORT_TEMP" before 3d export file (IGES, STEP, ...) is created.

Why

• https://redmine.buw-soft.de/issues/14469

• Not needed datums like points, axes and planes are obstructive in downstream processes.

How

Embedded axes in Extrude or Hole features are also considered.



What

Why

 Remove enforced regeneration of assembly to avoid continuous update of model data.

https://redmine.buw-soft.de/issues/14267

 SE automatically regenerates models with status "modified/outdated". That is displayed by regeneration flag in status-bar.



- In some cases, Creo does not remove regen flag after successful regeneration.
- This leads to repeated regeneration of whole assembly if workpiece is affected.
- In such a case further processing is difficult, because of waiting times.

How

- Remove automatic regeneration.
- Users are now responsible to update design data when necessary.



Description

Cause

Solution

- Fix usage of wrong simplified representation in drawing repeat region after another drawing is merged.
- https://redmine.buw-soft.de/issues/7504

Problem appears if:

- user already created a drawing with repeat region
- adds a new electrode
- runs drawing creation again to add new sheet to drawing
- first repeat region may be changed to show data of merged drawing

SMARTElectrode automatically updates first occurrence of tables on drawing loaded from "asm_edm.tbl" and "asm_operation.tbl" after drawing creation.



SMARTElectrode 14.1.0.0

What's New





Description

Cause

Solution

- Allow renaming of manufacturing assembly and workpiece in Manufacturing
 UI and Rename UI.
- https://redmine.buw-soft.de/issues/13988
- A renamed electrode may not meet the naming format anymore
- Allow edit of default MFG and workpiece name in Manufacturing UI.
- Allow adjusting of names of existing MFG and workpiece during rename.
- Double click Mfg or Workpiece name in Manufacturing UI to edit names for objects to create (). Existing assemblies and parts () can't be renamed Manufacturing UI.
- Rename UI shows input panels for MFG and workpiece if available.








What

- Prefer template without rotation (C=0°) if several templates with same blank dimensions are available.
- https://redmine.buw-soft.de/issues/13672
- Order of templates in .dat decided which template with or without rotation was assigned. This is improved by defined behavior.

How

Why

	Current Sehavior	A B	0.00	A V	
Z	5.0000	С	90.00	¥	
Blank					
Туре	RECTANGULAR	_BASE		-	
Size	10X50			-	

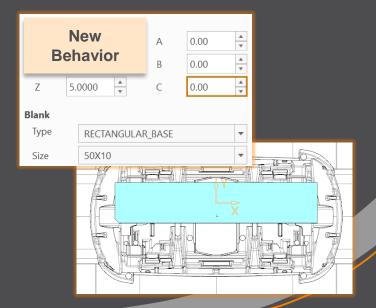



Description

- Ignore rotation of EDM_ORIGIN for default start and secure position
- https://redmine.buw-soft.de/issues/13878

Cause

- In some cases a rotated EDM_ORIGIN is useful
 - Easier definition of start position
 - EDM_ORIGIN is rotated for later NC setup
- In both cases either the calculated angles or the display are wrong



SX	SY	SZ	SA
0.000	18.887	1.571	-45.000

Solution

- Applied rotation to EDM_ORIGIN is ignored for calculation of angles.
- SE_EDM_BASE is used for electrodes created in current releases.
- EDM_ORIGIN is used for electrodes created in versions prior 8.0.



SX	SY	SZ	SA
0.000	18.887	1.571	0.000




What


Why

How

BREAKING CHANGE

- Consider contour height on calculation of default start- and secure-position. https://redmine.buw-soft.de/issues/13762
- Calculation of default start and secure position using EDM_ORIGIN led to disadvantageous or wrong values.
- Reduce effort to set start and secure positions.
- NOTE: Adjustment of operation default planes may be necessary to respond appropriately to the new behavior.
- New behavior is available for all assemblies from current versions.

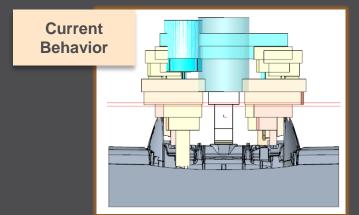

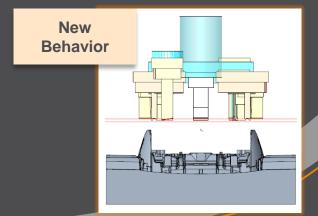



What

 Introduce new option #Electrode #LATERAL_KEEPOUT_DISTANCE https://redmine.buw-soft.de/issues/13766

Why

Defines the minimum distance in XY direction from the base that must not be


disturbed by workpiece geometry.

How

Default value '0'

 When adding a new base, position will be adjusted to...

> ...meet normal distance D1 and ...to fulfill lateral offset defined in LATERAL_KEEPOUT_DISTANCE

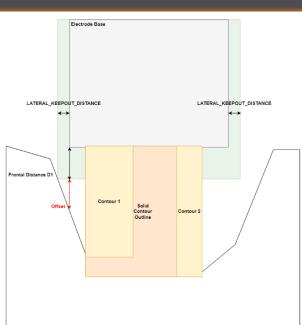



What


 Introduce new option #Electrode #SOLID_CONTOUR_CLEARANCE https://redmine.buw-soft.de/issues/13765

Why

 Necessary to specify the minimum clearance in XY direction between the contour and blank outline

How

- Option value SOLID_CONTOUR_CLEARANCE defines the clearance added to electrode's solid contour before blank size selection.
- Default value '0'

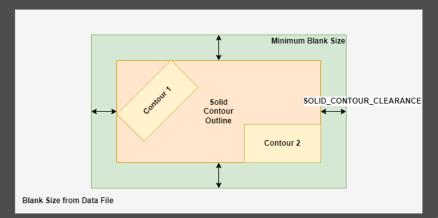



What

Allow enabling or disabling automatic calculation of a variable measure in the

Base UI. https://redmine.buw-soft.de/issues/13672

(related to: https://redmine.buw-soft.de/issues/12517)

Allows users to switch between both behaviors

How

Why

1. Variable dimension used (-1)

Variable dimension will be disabled and calculated automatically based on other inputs.

2. Blank unlocked

Z position of blank length should stay fixed on input.
Change of D2 changes D2 and D3.
Change of Z position changes LENGTH and D3 accordingly.
Change of LENGTH changes LENGTH and D3 accordingly.

3. Blank locked

Blank (A_BASE, B_BASE, LENGTH and D2) are disabled and can't be changed. Changes to D1, D3 or Z position change the other two dependent values accordingly.









What

 Allow export of files for Creo View https://redmine.buw-soft.de/issues/13699

Why

Provide data for downstream processes

How

- Use keywords "SE_EDM_BACKUP_PVS" or "SE_EDM_BACKUP_PVZ" in export template to create a file structure for Creo View (PVS) or a zipped archieve of the files (PVZ). PVS creates a *.pvs for the file structure and numerated *.ol files containing viewable geometry.
- Example: export PVS/PVZ of assembly

Assembly PVS: #SE_EDM_BACKUP_DIR#\#partname#.#SE_EDM_BACKUP_PVS# Assembly PVZ: #SE_EDM_BACKUP_DIR#\#partname#.#SE_EDM_BACKUP_PVZ#

Example: export PVS/PVZ for each electrode

ELECTRODE_START

PVS: #SE_EDM_BACKUP_DIR#\#partname#.#SE_EDM_BACKUP_PVS# PVZ: #SE_EDM_BACKUP_DIR#\#partname#.#SE_EDM_BACKUP_PVZ# ELECTRODE END



What

 Use default profiles or option files for 3D exports https://redmine.buw-soft.de/issues/13681

Why

Support of custom option files

How

Save options file named "def_profile" to export/<type> or processor/<type>.

Туре	Keyword in export template	Options file name
VDA	SE_EDM_BACKUP_VDA	def_profile.dep_vda
STEP	SE_EDM_BACKUP_STEP	def_profile.dep_step
IGES	SE_EDM_BACKUP_IGES	def_profile.dep_iges
CATIA	SE_EDM_BACKUP_CATIA	def_profile.dep_catv5
SAT (Acis)	SE_EDM_BACKUP_SAT	def_profile.dep_acis
NEUTRAL	SE_EDM_BACKUP_NEUTRAL	def_profile.dep_neu
X_T (Parasolid)	SE_EDM_BACKUP_X_T	def_profile.dep_para
UG (NX)	SE_EDM_BACKUP_UG	def_profile.dep_nx
JT (license necessary)	SE_EDM_BACKUP_JT	def_profile.dep_jt